

Work Order ID 109060

109060

Page 1

November-08-13 8:36:44 AM

Item ID: D412-664-209TRN

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Crosstube Turning Detail

Start Date: 11/08/13 Start Qty: 1.00 *1*

Cust Item ID:

Required Date: 11/22/13 Req'd Qty: 1.00 *1*

Customer:

Reference:

Approvals: Process Plan: MLJ Date: 13-11-08 Tooling: _____ Date: _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
----------	--------------

D412-664-249	Rev B(DEO)
--------------	------------

100

0.00

100

Mori Seiki

MORI SEIKI CNC LATHE LARGE

Memo

0.00

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs DT8534 on both ends as per Folio FA708

2-Turn first side as per Folio FA708

3- File transition lines smooth.

FOLIO REV: AA

DWG REV: B

13-11-12

PTO

110

QC1- Inspect dimensions to dimension sheet

0.00

110

QC

Memo

0.00

Quality Control

13-11-12

DQA:

Date: 14/01/24



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed:

Date: 14/1/23

Work Order update only ☐

Work Order: <u>109060</u>	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input checked="" type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS			
Part No. <u>D412-164 209 TRA</u>		Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>
NCR No. <u>14-3408</u>		Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>
		Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>
		Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling	13/11/23	100	1	Ultrasonic measurement over over tolerance at one location, Min wall is 0.03 under nominal.	DAS 12 9-89 13/11/23	Acceptable, within allowable of raw mat'l.	DAS 12 9-89 13/11/23	JW 13-11-26	Shp 13/11/23
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge	<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--	--

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td style="width: 33%;"> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </td> <td style="width: 33%;"> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </td> <td style="width: 33%;"> Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> </td> <td style="width: 33%;"> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/> </td> </tr> </table>	Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/>	Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/>	Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/>	Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/>
Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/>	Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/>	Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/>	Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/>			

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear	General		
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Folio/Program	<input type="checkbox"/> Outside Dimensions
<input type="checkbox"/> Centre Not Concentric	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Grain	<input type="checkbox"/> Over/Under tolerance
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damage/Defect	<input type="checkbox"/> Hardware	<input type="checkbox"/> Part Incorrect
<input type="checkbox"/> Crimp/Kink/Ripple/Wave	<input type="checkbox"/> Burrs	<input type="checkbox"/> Inspection Incomplete/Unqualified	<input type="checkbox"/> Part Lost/Missing
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Instructions Incomplete/Unclear	<input type="checkbox"/> Part Moved
<input type="checkbox"/> Crushing	<input type="checkbox"/> Countersink	<input type="checkbox"/> Misaligned/off center	<input type="checkbox"/> Positioned Wrong
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Mislabeled	<input type="checkbox"/> Power Loss/Surge
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Drawing	<input type="checkbox"/> Misread	<input type="checkbox"/> Pressure/Forced
<input type="checkbox"/> Marks/Chatter	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Off-set	<input type="checkbox"/> Set-up
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Calibration	<input type="checkbox"/> Temperature/Cure
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Fit/Function	<input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Weld
			<input type="checkbox"/> Wrong Stock Pulled
			<input type="checkbox"/> Other

Work Order ID 109060

November-08-13 8:36:44 AM

109060

Page 3

Item ID: D412-664-209TRN

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Crosstube Turning Detail

Start Date: 11/08/13 Start Qty: 1.00

1

Cust Item ID:

Required Date: 11/22/13 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

140

QC8- Inspect parts - second check

0.00

140

QC

Memo

0.00

Quality Control

TW 13-11-15

145

0.00

145

Crosstubes

Memo

0.00

Crosstubes

Grind machining mark longitude

mm.L
13/11/30

150

0.00

150

HandFXtube

Memo

0.00

Hand Finishing Crosstubes

1- PRESSURE WASH X-TUBE INSIDE AND OUT

2- ACID ETCH X-TUBE INSIDE AND OUT. USE RED SCOTCH BRITE

1 Ø

mm.L
13/11/30

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td style="width: 33%;"> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </td> <td style="width: 33%;"> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </td> <td style="width: 33%;"> Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> </td> <td style="width: 33%;"> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/> </td> </tr> </table>	Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/>	Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/>	Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/>	Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/>
Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/>	Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/>	Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/>	Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/>			

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

November-08-13 8:36:44 AM

Page 4

0.00

SW 14-01-09

14-01-24

14-01-10

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat-Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

Picklist Print

Page 1

November-08-13 8:36:47 AM

Work Order ID: 109060

109060

Parent Item: D412-664-209TRN

D412-664-209TRN

Parent Item Name: Crosstube Turning Detail

Start Date: 11/08/13

Required Date: 11/22/13

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:A New Issue 08-03-06 DD verified by:ec
IPP Rev B 08.04.02 Removed polish EC verified by: DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6009-129		Manufactured	No			110	Each	7.5000	1	1			

D6009-129

Crosstube Material

**

Location	Loc Qty	Loc Code
LG015	7.5	
75627	5	
75630	2.5	

1

KC

13-11-12

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width:100%;"> <tr> <td style="width:33%;"> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </td> <td style="width:33%;"> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </td> <td style="width:33%;"> Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> </td> <td style="width:33%;"> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/> </td> </tr> </table>	Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/>	Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/>	Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/>	Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/>
Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/>	Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/>	Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/>	Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/>			

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--


DART AEROSPACE LTD	Work Order: 109060
Description: Crosstube Assembly (412 Low Aft)	Part Number: D412-664-249
Inspection Dwg: D412-664-249 Rev: B	Page 1 of 2

FIRST ARTICLE INSPECTION CHECKLIST

	Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	0.625	+/-0.010	.625	/		vern	CNC-08
	2.680	+0.005/-0.000	2.683	/		mic	CNC-04
	2.680	+0.005/-0.000	2.685	/			
	2.687	+0.005/-0.000	2.690	/			
	2.793	+0.005/-0.000	2.797	/			
	2.930	+0.005/-0.000	2.935	/			
	3.067	+0.005/-0.000	3.071	/		mic	CNC-05
	3.205	+0.005/-0.000	3.209	/			
	3.358	+0.005/-0.000	3.363	/			
	3.378	+0.005/-0.000	3.381	/			
	3.500	+0.005/-0.000	3.500	/			
SIDE B	0.625	+/-0.010	.625	/		vern	CNC-08
	2.680	+0.005/-0.000	2.681	/		mic	CNC-04
	2.680	+0.005/-0.000	2.683	/			
	2.687	+0.005/-0.000	2.689	/			
	2.793	+0.005/-0.000	2.796	/			
	2.930	+0.005/-0.000	2.934	/			
	3.067	+0.005/-0.000	3.071	/		mic	CNC-05
	3.205	+0.005/-0.000	3.208	/			
	3.358	+0.005/-0.000	3.363	/			
	3.378	+0.005/-0.000	3.381	/			
	3.500	+0.005/-0.000	3.500	/			
	0.127.82	+/-0.020	127.84	/		TAPE	LG-25

DART AEROSPACE LTD	Work Order: 109060
Description: Crosstube Assembly (412 Low Aft)	Part Number: D412-664-249
Inspection Dwg: D412-664-249 Rev: B	Page 2 of 2

WALL THICKNESS MEASUREMENT

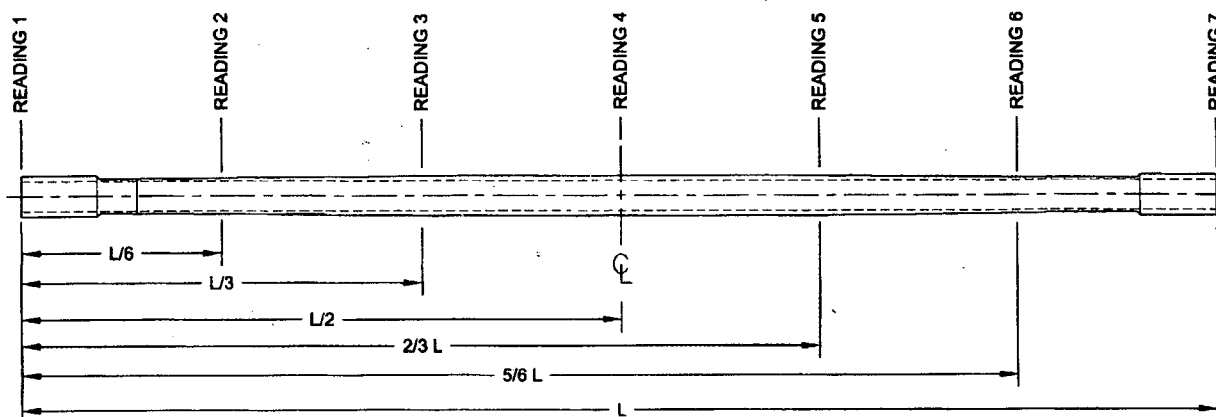

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"	.221	.221	.242	.230	.021	0.073"
READING 2 L= 18	.221	.242	.249	.223	.028	
READING 3 L= 38	.406	.419	.416	.393	-.026	
READING 4 L= 63	.640	.638	.649	.646	-.011	
READING 5 L= 38	.380	.448	.426	.362	.086	
READING 6 L= 18	.212	.250	.256	.217	.044	
READING 7 L= cuff	.238	.212	.225	.242	.036	

Dwg
0.392 0.07

Calibration Result

Actual Block Thickness: 100 - 250

Sitescan 250 Measured Thickness: 100 - 250

Measured by: mm.L
Date: 13/11/13

Audited by: JW
Date: 13.11.15

Preliminary Approval:
Date:

Rev	Date	Change	Revised by	Approved
A	08.11.07	New Issue (P/O D212-664-209)	KJ/EC	
B	10.11.12	Dwg Rev updated	KJ	
B	12.06.04	Wall thickness form added	KJ	

Item	Qty	Part Number	Description
1	X	D412-664-249	CROSSTUBE ASSEMBLY (412 LOW AFT)
2	1	D6009-129	CROSSTUBE
3	2	D2856-600-1009	ABRASION STRIP
4	1	D2896-1	SUPPORT
5	2	D3189-1	CHAFING SHIELD
6	2	D3595-063-570	RUBBER CUSHION
7	2	D3660-1	CUFF
8	44	CR3212-4-07	RIVET (OR M7885/3-4-07)
9	4	MS21920-28	CLAMP
10	2	MS21920-30	CLAMP (OR MS21920-32)
11	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
12	A/R	SIKAFLEX-241/-291	SEALANT (OR PROSEAL 890 OR MIL-S-8802 CLASS B2 SEALANT)

GENERAL NOTES:


- 1) MATERIAL: MANUFACTURED FROM D6009-129
- 2) FINISH: FINISHED LENGTH = 127.826±0.020 (BEFORE BENDING/TRIMMING)
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D412-664-249" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS.
- 7) WEIGHT: 42.5 lbs (PER IIN-D212-664)
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) WHEN MACHINING TAPER, RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D., EXCEPT UP TO 10% IS ALLOWED IN AREA NOTED.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2896-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2896-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-30 CLAMPS (OR -32) WITH D3595-063-570 RUBBER CUSHIONS TO SECURE THE D2896-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE SUPPORT.
- 14) INSTALL D2856-600-1009 ABRASION STRIPS WITH A 0.13 REF GAP ON BOTTOM SIDE OF CROSSTUBE PER QSI 035.
- 15) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 16) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.
- 17) INSTALL D3660-1 CUFF AFTER CHEMICAL CONVERSION COAT BUT BEFORE PAINT, WITH A LAYER OF SIKAFLEX-241/-291 OR PROSEAL 890 OR MIL-S-8802 CLASS B2 SEALANT BETWEEN CUFF AND CROSSTUBE. SEAL EDGE OF CUFF TO ENSURE NO GAPS.
- 18) TOUCH-UP HOLES WITH CHEMICAL CONVERSION COAT.

109060 MLJ
13-11-08


② DEO ATTACHED
RELEASED
2009-10-28
MP

B	REVISE GENERAL NOTES; UPDATE TO CURRENT STANDARDS	RF	09.09.30
A	NEW ISSUE	CP	07.07.07
REV.	DESCRIPTION	BY	DATE
DESIGN	RF	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	RF	DRAWING NO.	REV. B
MFG. APPR.	RF	D412-664-249	SHEET 1 OF 4
APPROVED	RF	TITLE	SCALE
DE APPR.	RF	CROSSTUBE (412 LOW AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2007 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	


109060

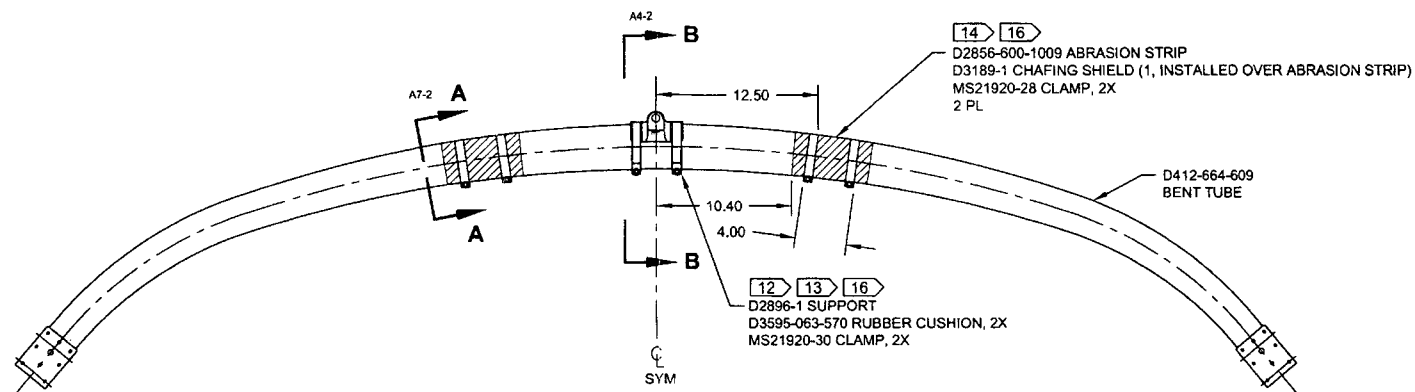

D412-664-249
ASSEMBLY DETAIL

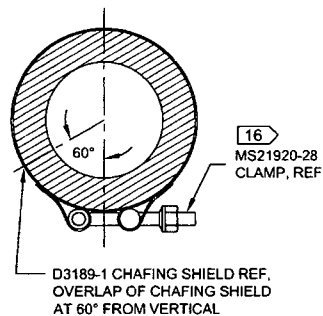

SECTION A-A D6-2
SCALE 4X

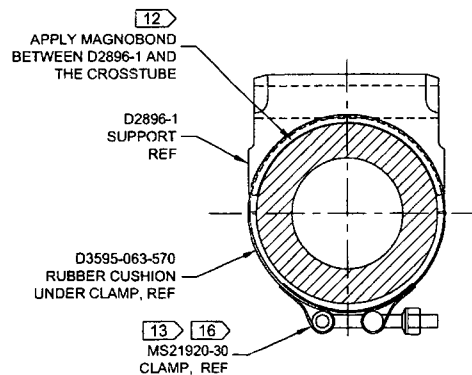


SECTION B-B D5-2
SCALE 4X


2 DEO ATTACHED
RELEASED
2009-10-29

DESIGN	RF	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	RF	DRAWING NO.	REV. B
MFG. APPR.	RF	D412-664-249	SHEET 2 OF 4
APPROVED	RF	TITLE	SCALE
DE APPR.	RF	CROSSTUBE (412 LOW AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2007 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	


109060

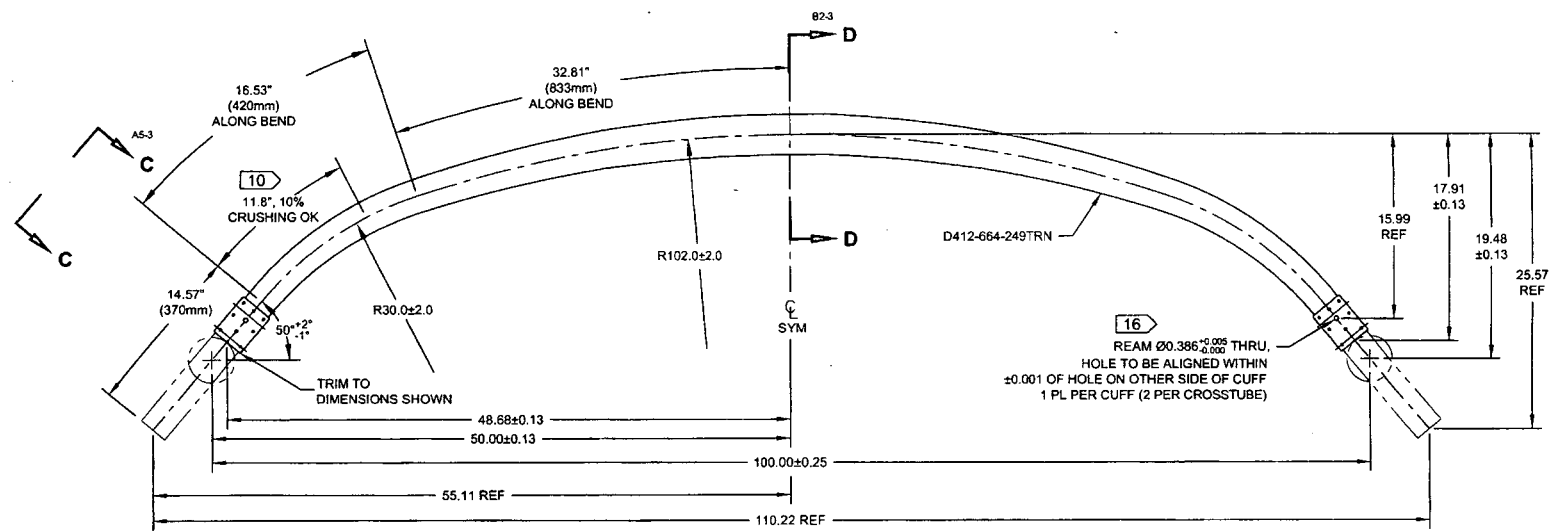

D412-664-609
BENDING AND DRILLING DETAIL 10 B

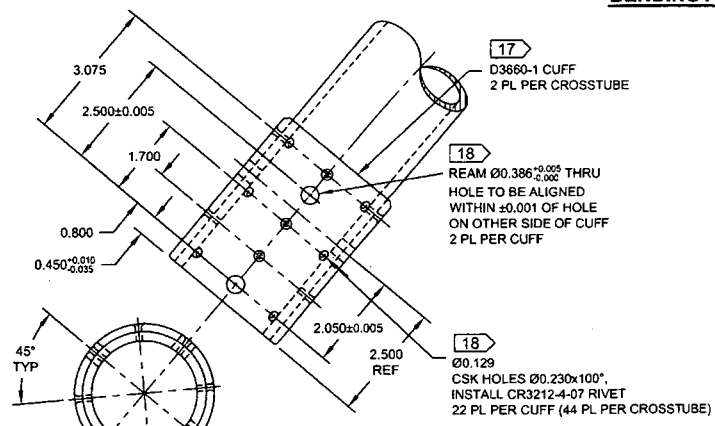

VIEW C-C: CUFF DETAIL D8-3
 SCALE 4X

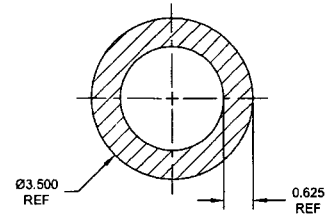


SECTION D-D D4-3
 SCALE 4X

2 DEO ATTACHED
RELEASED
 2009-10-29
 MD

DESIGN	RF	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	RF	DRAWING NO.	REV. B
MFG. APPR.	RF	D412-664-249	SHEET 3 OF 4
APPROVED	RF	TITLE	SCALE
DE APPR.	RF	CROSSTUBE (412 LOW AFT)	NTS
DATE	09.09.30	<small>COPYRIGHT © 2007 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

10906d

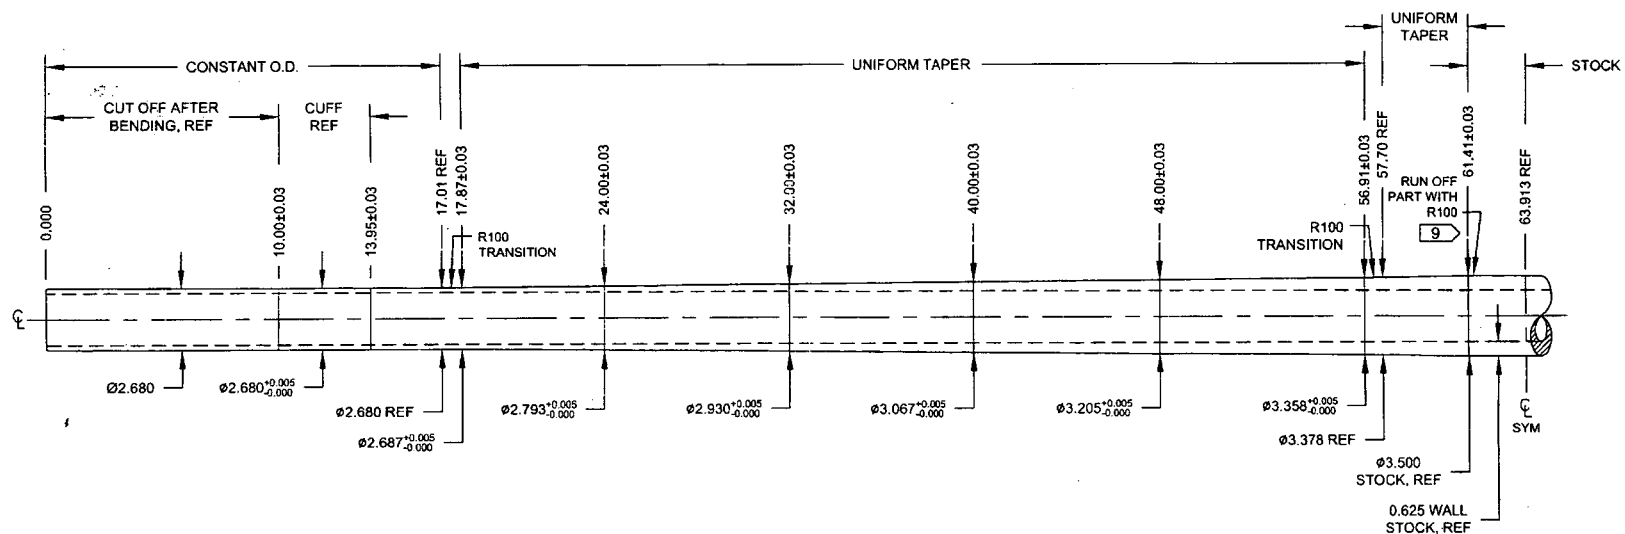

D412-664-249TRN
TURNING DETAIL

DEO ATTACHED

RELEASED
2009-10-29

DESIGN	97	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	97	DRAWING NO.	REV. B
MFG. APPR.	18	D412-664-249	SHEET 4 OF 4
APPROVED	12	TITLE	SCALE
DE APPR.	14	CROSSTUBE (412 LOW AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2007 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

109060

DRAWING NO. D412-664-249	TITLE CROSSTUBE ASS'Y (412 LOW AFT)	REV. B	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D412-664-249-B-1	SHEET NO. SHEET 1 OF 2	SCALE NTS
DRAWN <i>Q</i>	CHECKED <i>Sc</i>	MFG. APPR. <i>E</i>	APPROVED <i>MD</i>	DE APPR. <i>MD</i>		
DATE 11.05.25	DATE 11.05.31	DATE 11.05.31	DATE 11/05/31	DATE 11.05.31		

PURPOSE:

REMOVED ABRASION STRIP IN FAVOR OF A THIN LAYER OF PROSEAL 890.

CHANGE:

PARTS LIST IS AMENDED AS FOLLOWS:

IS:

Item	Qty -249	Part Number	Description
3	0	D2856-600-1009	ABRASION STRIP

WAS:

3	2	D2856-600-1009	ABRASION STRIP
---	---	----------------	----------------

NOTE 14, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 14) APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D3189-1 CHAFING SHIELD AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL PROSEALED D3189-1 CHAFING SHIELD ONTO CROSSTUBE BY APPLYING A THIN COAT OF PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.

WAS:

- 14) INSTALL D2856-600-1009 ABRASION STRIPS WITH A 0.13 REF GAP ON BOTTOM SIDE OF CROSSTUBE PER QSI 035.

RELEASED
2011-07-14
MD

109060

DRAWING NO. D412-664-249	TITLE CROSSTUBE ASS'Y (412 LOW AFT)	REV. B	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D412-664-249-B-1	SHEET NO. SHEET 2 OF 2	SCALE NTS
DRAWN 97	CHECKED Sc	MFG. APPR. E	APPROVED MD	DE APPR. H		
DATE 11.05.25	DATE 11.05.31	DATE 11.05.31	DATE 11/05/31	DATE 11.05.31		

IS:

D3189-1 CHAFING SHIELD (1, INSTALLED OVER PROSEAL 890)
MS21920-28 CLAMP, 2X
2 PL

D412-664-609
BENT TUBE

WAS:

D2856-600-1009 ABRASION STRIP
D3189-1 CHAFING SHIELD (1, INSTALLED OVER ABRASION STRIP)
MS21920-28 CLAMP, 2X
2 PL

D3189-1
REF

Q
SYM

D412-664-249
ASSEMBLY DETAIL

RELEASED
2011-07-14
MD

COPYRIGHT © 2011 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE LTD.

109060

DRAWING NO. D412-664-249	TITLE CROSSTUBE ASS'Y (412 LOW AFT)	REV. B	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D412-664-249-B-2	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN 9	CHECKED AS	MFG. APPR. E	APPROVED WAP		DE APPR. H		
DATE 11.09.07	DATE 11.09.19	DATE 11.09.19	DATE 11.09.19		DATE 11.09.19		

PURPOSE:

REPLACE MAGNOBOND WITH 3M DP460 SCOTCH-WELD EPOXY ADHESIVE

CHANGE:

IS:

Item	Qty -249	Part Number	Description
11	A/R	SCOTCH-WELD DP460	EPOXY ADHESIVE, 3M SCOTCH-WELD

WAS:

11	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
----	-----	----------------	---

NOTE 12 & 16, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) INSTALL D2896-1 CENTER SUPPORT USING A 0.04" TO 0.07" THICK LAYER OF SCOTCH-WELD DP460 PER QSI 015. LET CURE FOR 24 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 16) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. **PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER ADHESIVE HAS CURED FOR 24 HOURS.**

WAS:

- 12) INSTALL D2896-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2896-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 16) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RELEASED
2011-09-29
M

109060

DRAWING NO. D412-664-249	TITLE CROSSTUBE (412 LOW AFT)	REV. B	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D412-664-249-B-3	SHEET NO. SHEET 1 OF 3	SCALE NTS
DRAWN <i>q</i>	CHECKED <i>h</i>	MFG. APPR. <i>h</i>	APPROVED <i>h</i>	DE APPR. <i>h</i>			
DATE 12.08.21	DATE 12.08.30	DATE 12.08.30	DATE 12.08.30	DATE 12.08.30	DATE 12.08.30		

PURPOSE:

REMOVED ABRASION STRIP IN FAVOR OF A THIN LAYER OF PROSEAL 890. UPDATE INSTALLATION OF CHAFING SHIELDS AND REDUCE TORQUE TO 40-50 IN-LBS. THIS ENGINEERING ORDER SUPERCEDES DEO D412-664-249-B-1

CHANGE:

PARTS LIST IS AMENDED AS FOLLOWS:

IS:

Item	Qty -249	Part Number	Description
3	0	D2856-600-1009	ABRASION STRIP

WAS:

3	2	D2856-600-1009	ABRASION STRIP
---	---	----------------	----------------

NOTE 14 AND 16 ON SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 14) APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D3189-1 CHAFING SHIELD AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL PROSEALED D3189-1 CHAFING SHIELD ONTO CROSSTUBE BY APPLYING A THIN COAT OF PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.
- 16) TORQUE CLAMPS ON D2896-1 SUPPORT 80 TO 100 IN-LB. **TORQUE CLAMPS ON D3189-1 CHAFING SHIELD 40 TO 50 IN-LB.** ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

WAS:

- 14) INSTALL D2856-600-1009 ABRASION STRIPS WITH A 0.13 REF GAP ON BOTTOM SIDE OF CROSSTUBE PER QSI 035.
- 16) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RELEASED
2012-09-04
MP

COPYRIGHT © 2012 BY DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

109060

DRAWING NO. D412-664-249	TITLE CROSSTUBE (412 LOW AFT)	REV. B	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D412-664-249-B-3	SHEET NO. SHEET 2 OF 3	SCALE NTS
DRAWN <i>92</i>	CHECKED <i>A</i>	MFG. APPR. <i>A</i>	APPROVED <i>MD</i>	DE APPR. <i>MD</i>		
DATE 12.08.21	DATE 12.08.22	DATE 12.08.29	DATE 12.08.29	DATE 12.08.29		

IS:

D3189-1 CHAFING SHIELD (1, INSTALLED OVER PROSEAL 890)
MS21920-28 CLAMP, 2X
2 PL

D412-664-609
BENT TUBE

4.00
CLAMP SPACING
4.38
CHAFING SHIELD, REF

WAS:

14 16

D2856-600-1009 ABRASION STRIP
D3189-1 CHAFING SHIELD (1, INSTALLED OVER ABRASION STRIP)
MS21920-28 CLAMP, 2X
2 PL

D3189-1
REF

C
SYM


D412-664-249
ASSEMBLY DETAIL

RELEASED
2012-09-04
MD

COPYRIGHT © 2012 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE LTD.

109060

DRAWING NO. D412-664-249	TITLE CROSSTUBE (412 LOW AFT)	REV. B	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D412-664-249-B-3	SHEET NO. SHEET 3 OF 3	SCALE NTS
DRAWN <i>q</i>	CHECKED <i>J</i>	MFG. APPR. <i>M</i>	APPROVED <i>MD</i>	DE APPR. <i>#</i>		
DATE 12.08.21	DATE 12.08.22	DATE 12.08.29	DATE 12.08.29	DATE 12.08.29		

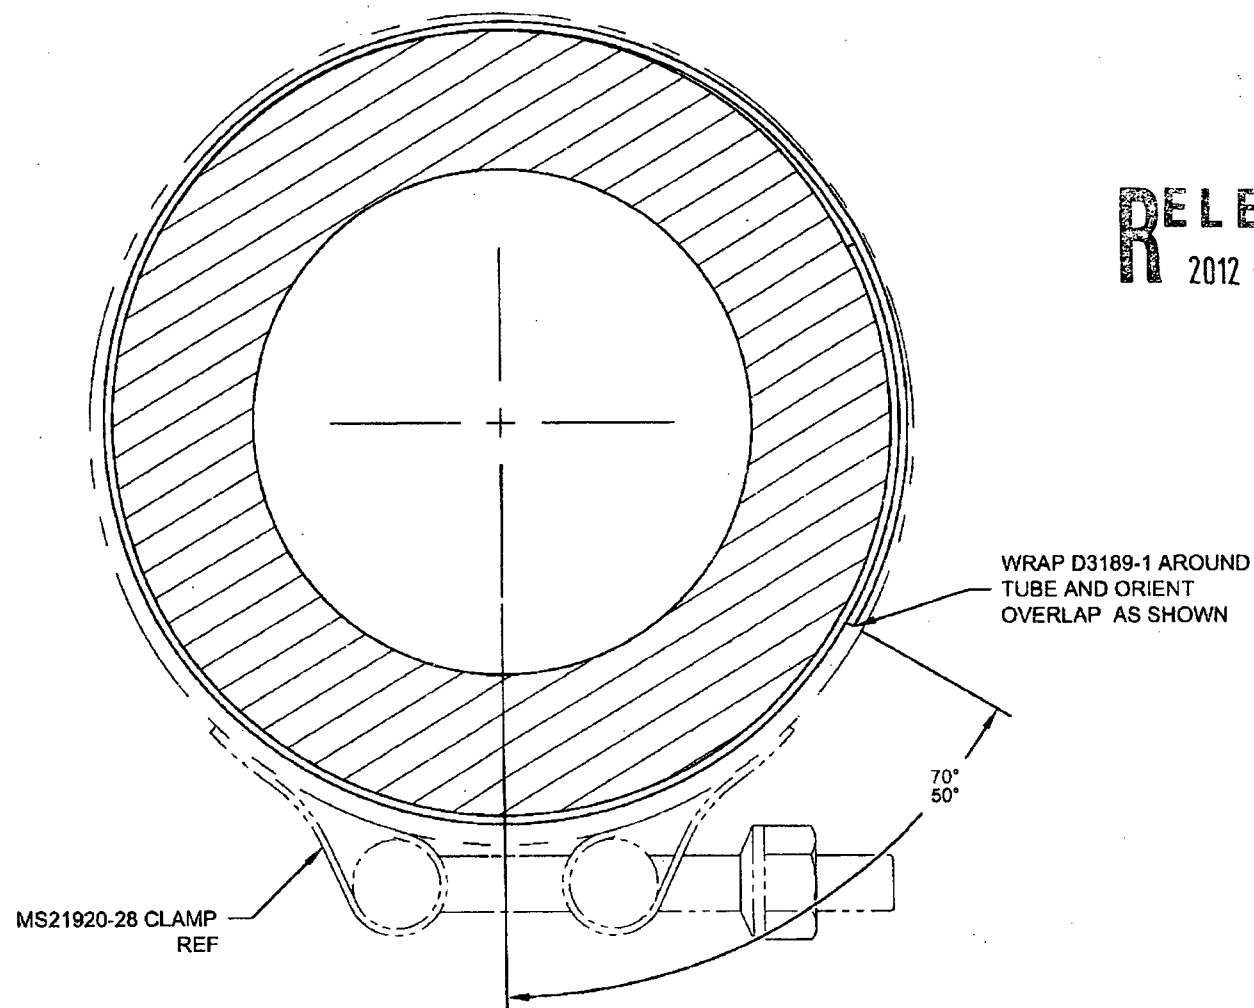

RELEASED
2012-09-04
MD

SECTION A-A
CHAFING SHIELD DETAIL
VIEW ROTATED, NOT TO SCALE

COPYRIGHT © 2012 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE LTD.